
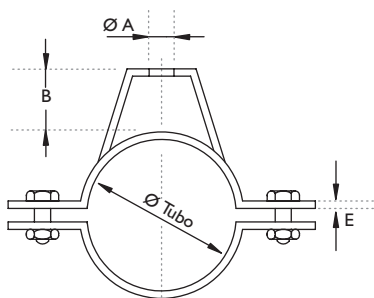


Abraçadeira União Horizontal

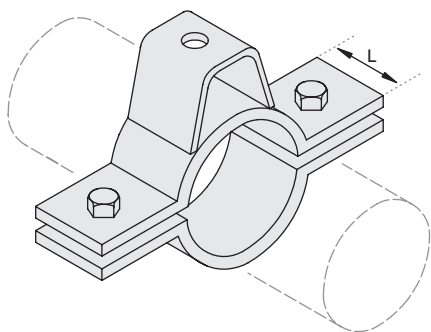

Acompanha Porcas e Parafusos Sextavados

Referência	Ø Tubo (pol)	Ø Tubo (mm)	Ø A (mm)	B (mm)	L (mm)	E (pol)
S 4.351	1/2"	21,3	11	35	32	3/16"
S 4.352	3/4"	26,6	11	35	32	3/16"
S 4.353	1"	33,4	11	35	32	3/16"
S 4.354	1 1/4"	42,1	11	35	32	3/16"
S 4.355	1 1/2"	48,2	11	35	32	3/16"
S 4.356	2"	60,3	11	35	32	3/16"
S 4.357	2 1/2"	73,0	14	45	38	1/4"
S 4.358	3"	88,9	14	45	38	1/4"
S 4.359	3 1/2"	101,6	14	45	38	1/4"
S 4.360	4"	114,3	14	50	38	1/4"
S 4.361	5"	141,3	14	50	38	1/4"
S 4.362	6"	168,3	14	50	38	1/4"
S 4.363	8"	219,1	14	55	38	1/4"
S 4.364	10"	273,0	14	55	38	1/4"
S 4.365	12"	323,8	14	55	38	1/4"

Abraçadeira União Vertical

Referência	Ø Tubo (pol)	Ø Tubo (mm)	Ø A (mm)	B (mm)	L (mm)	E (pol)
S 4.371	1/2"	21,3	11	85	32	3/16"
S 4.372	3/4"	26,6	11	85	32	3/16"
S 4.373	1"	33,4	11	85	32	3/16"
S 4.374	1 1/4"	42,1	11	85	32	3/16"
S 4.375	1 1/2"	48,2	11	85	32	3/16"
S 4.376	2"	60,3	11	85	32	3/16"
S 4.377	2 1/2"	73,0	14	100	38	1/4"
S 4.378	3"	88,9	14	100	38	1/4"
S 4.379	3 1/2"	101,6	14	100	38	1/4"
S 4.380	4"	114,3	14	100	38	1/4"
S 4.381	5"	141,3	14	110	38	1/4"
S 4.382	6"	168,3	14	110	38	1/4"
S 4.383	8"	219,1	14	110	38	1/4"
S 4.384	10"	273,0	14	110	38	1/4"
S 4.385	12"	323,8	14	110	38	1/4"

Acompanha Porcas e Parafusos Sextavados

